

Crack Monitoring - Results

No / Name
Date 26/03/26

Time 11:00:00

Survey No 013

Weather Sunny / Clear | 6°C

Survey Notes

All points recorded.

General Notes

- Absolute accuracy, refer to setup report.
- Points are referenced to a local grid.
- Negative dElev indicates point has dropped.
- Differences rounded to nearest 0.5 mm

Gauge No	Gauge Type	Location Comment	Readings - Base		Readings - Surveyed		Differences	
			b X	b Y	s X	s Y	d X	d Y
D1	Demec	Ground - Kitchen wall to lounge	53.77		57.66		3.89	
D11	Demec	Ground - Kitchen wall to lounge	93.67		94.12		0.45	
D12	Demec	Ground - Kitchen wall to lounge	100.77		100.57		-0.20	
D2	Demec	Ground - Top right of rear patio wall	26.29		26.72		0.43	
D21	Demec	Ground - Top right of rear patio wall	28.06		28.09		0.03	
D22	Demec	Ground - Top right of rear patio wall	36.65		36.42		-0.23	
D3	Demec	Ground - Lounge, top left of window	33.51		33.64		0.13	
D31	Demec	Ground - Lounge, top left of window	68.23		67.89		-0.34	
D32	Demec	Ground - Lounge, top left of window	76.71		76.52		-0.19	
D4	Demec	1st Floor - Bedroom opposite top of stairs, flank wall, plinth	38.39		38.66		0.27	
D41	Demec	1st Floor - Bedroom opposite top of stairs, flank wall, plinth	38.01		38.23		0.22	
D42	Demec	1st Floor - Bedroom opposite top of stairs, flank wall, plinth	53.81		53.79		-0.02	
D5	Demec	1st Floor - Main bathroom sloping ceiling	43.73		44.09		0.36	
D51	Demec	1st Floor - Main bathroom sloping ceiling	46.59		46.45		-0.14	
D52	Demec	1st Floor - Main bathroom sloping ceiling	65.01		64.69		-0.32	
D6	Demec	1st Floor - Master bedroom, corner on flank / front of property	15.85		15.79		-0.06	
D61	Demec	1st Floor - Master bedroom, corner on flank / front of property	25.24		25.38		0.14	
D62	Demec	1st Floor - Master bedroom, corner on flank / front of property	28.77		28.64		-0.13	
D7	Demec	Ground - Top left hand corner of front door	40.04		42.77		2.73	
D71	Demec	Ground - Top left hand corner of front door	60.93		60.86		-0.07	
D72	Demec	Ground - Top left hand corner of front door	47.63		47.66		0.03	
D8	Demec	First Floor - Gym room to left hand of velux	44.15		44.47		0.32	
D81	Demec	1st Floor - Gym room to left hand of velux	53.85		53.76		-0.09	
D82	Demec	1st Floor - Gym room to left hand of velux	72.84		72.85		0.01	

Crack Monitoring - Graphs

No / Name

Date 26/03/26
Time 11:00:00
Survey No 013
Weather Sunny / Clear | 6°C

Survey Notes

All points recorded.

General Notes

- The X/Y readings are the differences from the base readings.
- Demec studs only show an X reading.

Point ID


D4

Location

1st Floor - Bedroom opposite top of stairs, flank wall, plinth

Survey No	Date	X	Y
1	START	0.00	
2	16/06/23	0.10	
3	24/08/23	0.03	
4	17/10/23	0.34	
5	12/01/24	0.19	
6	05/03/24	0.33	
7	02/05/24	0.41	
8	23/07/24	-0.05	
9	10/12/24	0.30	
10	03/07/25	0.04	
11	07/08/25	0.05	
12	20/11/25	0.27	
13	26/03/26	0.27	

Vertical & Horizontal Movement Graph

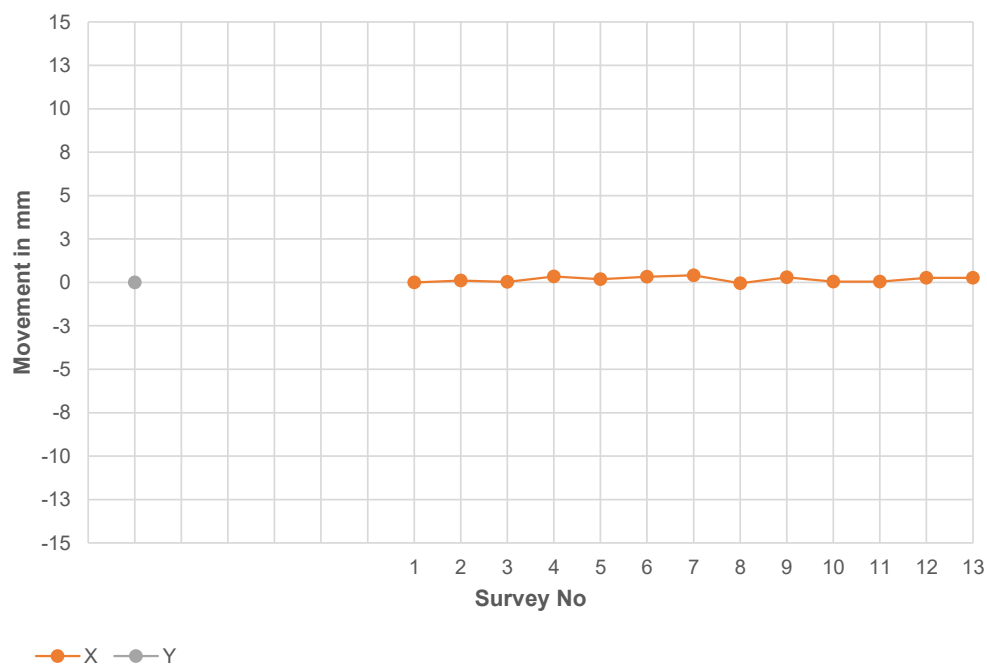

Crack Monitoring - Graphs

No / Name

Date 26/03/26
Time 11:00:00
Survey No 013
Weather Sunny / Clear | 6°C

Point ID

D3

Location

Ground - Lounge, top left of window

Survey Notes


All points recorded.

General Notes

- The X/Y readings are the differences from the base readings.
- Demec studs only show an X reading.

Survey No	Date	X	Y
1	START	0.00	
2	16/06/23	-0.03	
3	24/08/23	-0.08	
4	17/10/23	0.00	
5	12/01/24	-0.01	
6	05/03/24	0.12	
7	02/05/24	0.19	
8	23/07/24	0.24	
9	10/12/24	0.18	
10	03/07/25	0.30	
11	07/08/25	0.30	
12	20/11/25	0.11	
13	26/03/26	0.13	

Vertical & Horizontal Movement Graph

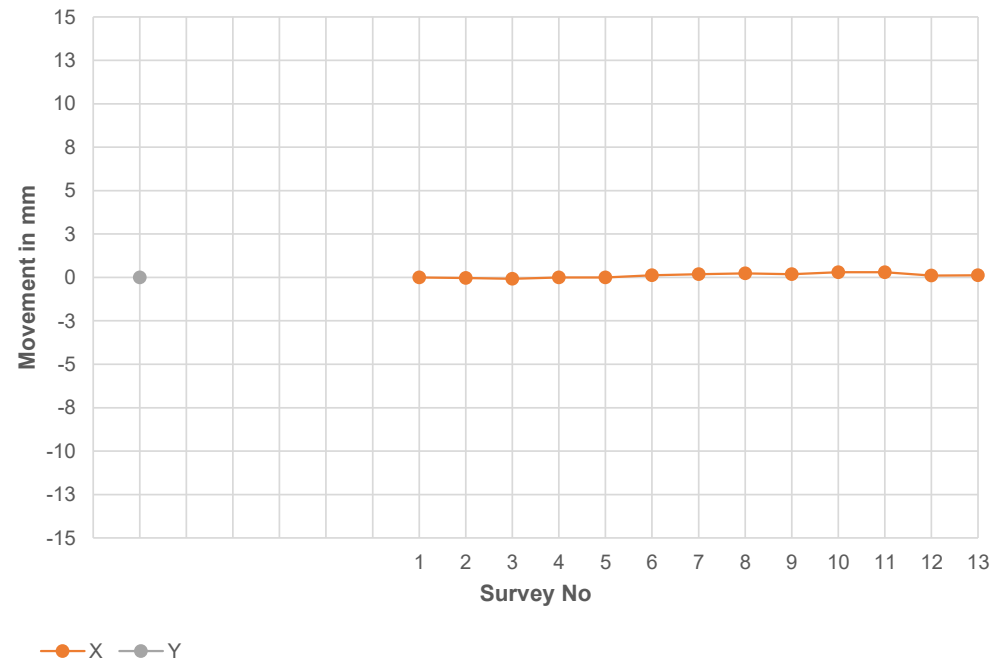

Crack Monitoring - Graphs

No / Name

Date 26/03/26
Time 11:00:00
Survey No 013
Weather Sunny / Clear | 6°C

Point ID

D2

Location

Ground - Top right of rear patio wall

Survey Notes


All points recorded.

General Notes

- The X/Y readings are the differences from the base readings.
- Demec studs only show an X reading.

Survey No	Date	X	Y
1	START	0.00	
2	16/06/23	0.01	
3	24/08/23	0.16	
4	17/10/23	-0.03	
5	12/01/24	-0.03	
6	05/03/24	0.25	
7	02/05/24	0.22	
8	23/07/24	0.29	
9	10/12/24	0.25	
10	03/07/25	0.42	
11	07/08/25	0.27	
12	20/11/25	0.52	
13	26/03/26	0.43	

Vertical & Horizontal Movement Graph

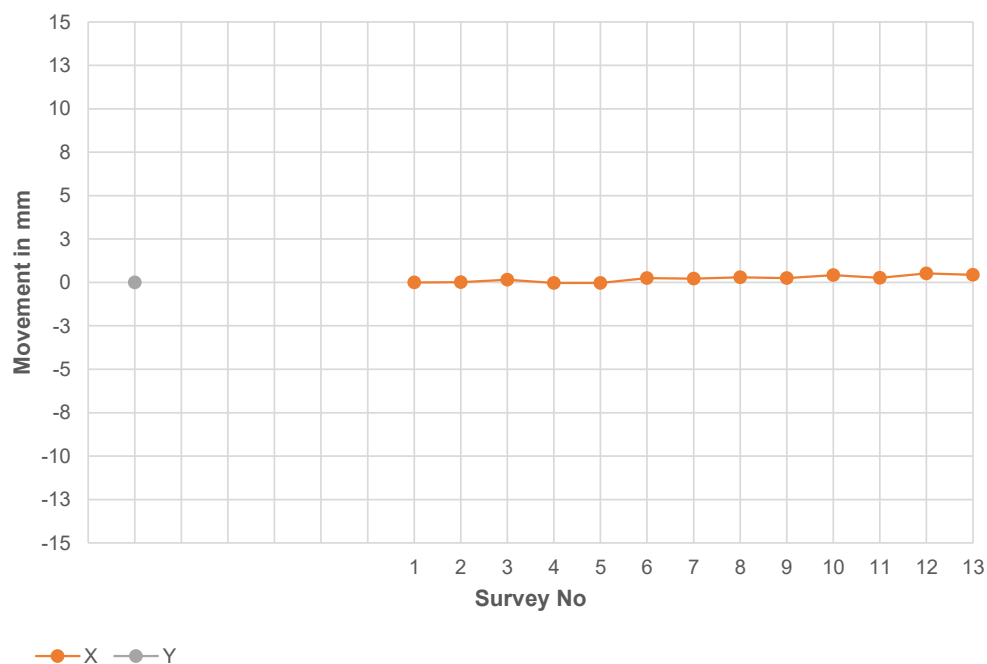

Crack Monitoring - Graphs

No / Name

Date 26/03/26
Time 11:00:00
Survey No 013
Weather Sunny / Clear | 6°C

Survey Notes

All points recorded.

General Notes

- The X/Y readings are the differences from the base readings.
- Demec studs only show an X reading.

Point ID

D1

Location

Ground - Kitchen wall to lounge

Survey No	Date	X	Y
1	START	0.00	
2	16/06/23	0.43	
3	24/08/23	0.54	
4	17/10/23	1.06	
5	12/01/24	1.29	
6	05/03/24	1.47	
7	02/05/24	1.64	
8	23/07/24	1.84	
9	10/12/24	2.43	
10	03/07/25	3.13	
11	07/08/25	3.22	
12	20/11/25	3.44	
13	26/03/26	3.89	

Vertical & Horizontal Movement Graph

